



## Vehicle Data

Vehicle ID no TMB [redacted] 232  
 Delivery date 2017-03-11  
 Next main inspection 2023-11  
 Next exhaust emissions test 2023-11  
 Type 5E538C



## Service History



ALL

WARRANTY

MAINTENANCE

DIGITAL SERVICE SCHEDULE

CANCELLATION

VIEW COPY

Explain ▼

Reception date:  
2021-12-21

Mileage:  
208830

Order no:  
2102 [redacted]

Invoice no.:  
2212 [redacted]

### Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	58511901	Rear door removed+installed	-	0000		0
2	58516710	Rear door parts removed for paintin	-	0000		0
3	58516910	Rear door parts installed after pai	-	0000		0
4	70391901	Lock carrier cover removed+installe	-	0000		0
5	66761900	Rear wheel housing liner rem+inst	-	0000		0
6	55371900	Fuel tank flap removed+installed	-	0000		0
7	63691901	Rear bumper cover removed+installed	-	0000		0
8	66775501	Steinschlagecke hinten ersetzt	-	0000		0
9	01500000	GFF/Guided functions .	-	0000		0
10	51020099	Einsatz von Richtgerät VAS 6321(Mir	-	0000		0
11	51017501	Body cavity preserved	-	0000		0
12	53556300	Rear side panel planished	-	0000		0



ALL

WARRANTY

MAINTENANCE

DIGITAL SERVICE SCHEDULE

CANCELLATION

VIEW COPY

Explain ▼

Reception date:  
2021-09-29Mileage:  
202295Order no:  
2101 Invoice no.:  
1311 

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	01226666	Annahme am Counter	-	0000		0
2	01500000	GFF/Guided functions .	-	0000		0
3	27068999	Bordnetzspannung aufrecht erhalten	-	0000		0
4	28841933	Glow plug removed+installed	-	0000		0
5	99999999	Fahrgeräusche geprüft.	-	0000		0

## Part item

#	Number	Description	Quantity	Factory code	TG	PG	Cause code	Package
1	03L963319D	GLOW PLUG	1.00	C	OWN	01	0	0

Explain ▼

Reception date:  
2021-07-22Mileage:  
196412Order no:  
2101 Invoice no.:  
3316 

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	58511901	Rear door removed+installed	-	0000		0
2	58516710	Rear door parts removed for paintin	-	0000		0
3	58516910	Rear door parts installed after pai	-	0000		0
4	70391901	Lock carrier cover removed+installe	-	0000		0
5	66761900	Rear wheel housing liner rem+inst	-	0000		0
6	55371900	Fuel tank flap removed+installed	-	0000		0
7	63691901	Rear bumper cover removed+installed	-	0000		0
8	66775501	Steinschlagecke hinten ersetzt	-	0000		0
9	01500000	GFF/Guided functions .	-	0000		0
10	51020099	Einsatz von Richtgerät VAS 6321(Mir	-	0000		0
11	51017501	Body cavity preserved	-	0000		0
12	53556300	Rear side panel planished	-	0000		0



ALL

WARRANTY

MAINTENANCE

DIGITAL SERVICE SCHEDULE

CANCELLATION

VIEW COPY

Explain ▼

Reception date:  
2021-07-19Mileage:  
196412Order no:  
2101 Invoice no.:  
3316 

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	51017133	Body painting prepared	-	0000		0
2	51017195	Body painting prepared	-	0000		0
3	53557923	Rear side panel painted	-	0009		0
4	55377952	Fuel tank flap painted	-	0001		0
5	64757750	Side window covered	-	0000		0
6	58517963	Rear door painted	-	0006		0
7	58117953	Door handle painted	-	0001		0
8	99999997	Beklebung Tür hinten rechts entfernen	-	0000		0

Explain ▼


Reception date:  
2021-07-07Mileage:  
196412Order no:  
2101 Invoice no.:  
1912 

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	44051900	Wheel removed+installed	-	0000		0
2	44405550	Tyre replaced	-	0000		0

## Part item

#	Number	Description	Quantity	Factory code	TG	PG	Cause code	Package
1	ZTW205556HB050	REIFEN BRI	1.00	C	OWN	41	0	0
2	ZUBKLEBE	GEWICHT	2.00	F	6	54	0	0
3	311601361	Valve	1.00	C	OWN	03	0	0

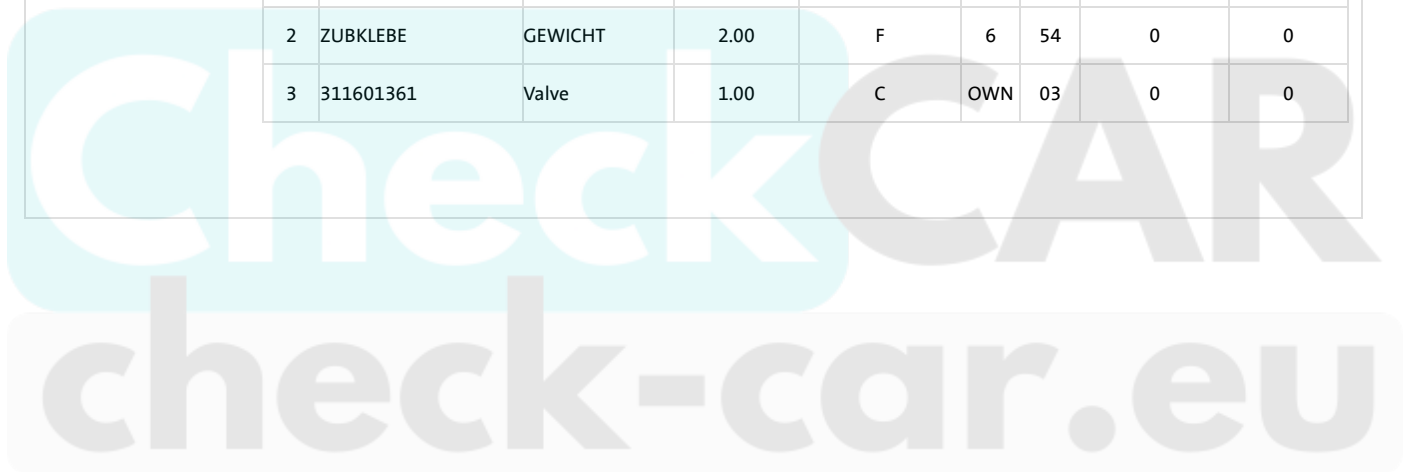



ALL

WARRANTY

MAINTENANCE

DIGITAL SERVICE SCHEDULE

CANCELLATION

VIEW COPY

Explain

Reception date:  
2021-07-07Mileage:  
196412Order no:  
2101 Invoice no.:  
1912 

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	99999997	Beklebung Tür hinten rechts entfernen	-	0000		0
2	58511901	Tür hinten aus- u.eingebaut	-	0000		0
3	58516710	Tür hinten Teile f Lackierung Ausge	-	0000		0
4	58516910	Tür hinten Teile n.Lackierung einge	-	0000		0
5	70391901	Abdeckung f Schloßträger aus-	-	0000		0
6	66761900	Radhausschale hinten aus- u.eingeba	-	0000		0
7	55371900	Tankklappe aus- u.eingebaut	-	0000		0
8	63691901	Abdeckung f Stoßfänger hinten aus-	-	0000		0
9	66775501	Steinschlagecke hinten ersetzt	-	0000		0
10	99999998	Einsatz von Richtgerät VAS 6321(Mir	-	0000		0
11	51017501	Karosserie konserviert	-	0000		0
12	53556300	Seitenteil hinten ausgebeult	-	0000		0
13	01500000	GFS/GEFÜHRTE FUNKTION .	-	0000		0
14	99979997	Fahrzeugverbringung zum Lackierer	-	0000		0
15	51017133	Karosserie Lackierung vorbereitet	-	0000		0
16	51017195	Karosserie Lackierung vorbereitet	-	0000		0
17	53557923	Seitenteil hinten lackiert	-	0000		0
18	55377952	Tankklappe lackiert	-	0000		0
19	64757750	Seitenfensterscheibe abgedeckt.	-	0000		0
20	58517963	Tür hinten lackiert	-	0000		0
21	58117953	Türgriff Lackiert	-	0000		0

## Part item

#	Number	Description	Quantity	Factory code	TG	PG	Cause code	Package
1	N 90974701	Bolt	12.00	C	OWN	01	0	0
2	WHT003737	Nut	8.00	C	OWN	01	0	0
3	5E0807906A	Schutzfoli	1.00	C	OWN	14	0	0
4	5E9839478 5AP	ABDICHTUNG	1.00	C	OWN	14	0	0



ALL

WARRANTY

MAINTENANCE

DIGITAL SERVICE SCHEDULE

CANCELLATION

VIEW COPY

Digital Service  
Schedule Reception date:  
2021-02-18Mileage:  
180578Order no.:  
65 Service record:  
Inspection with Oil  
change (flexible)

## Additional tasks

#	Number	Description
1	85185550	Dust and pollen filter
2	20345550	Diesel fuel filter
3	23245550	Air cleaner element
4	34015550	Gearbox oil
5	01400050	Brake fluid service
6	01390050	Additional Inspection scope

Explain

Reception date:  
2021-02-18Mileage:  
180578Order no.:  
65 Invoice no.:  
300 Remark  
Warranty/goodwill

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	01943699	Batterie an Ladegerät anschließen	-	0000		0
2	23602599	Motorsteuergerät SW- Aktualisierung	-	0000		0

Explain

Reception date:  
2021-02-18Mileage:  
180578Order no.:  
65 Invoice no.:  
300 Remark  
Maintenance

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	00003099	Intervallservice	-	0000		0
2	01030000	Inspections w.oil change .	X	0000		0
3	01390050	Additional Inspection scope .	X	0000		0
4	34015550	Gearbox oil replaced	-	0000		0

Explain

Reception date:  
2020-07-28Mileage:  
157800Order no.:  
53 Invoice no.:  
101 

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	00003099	STEUERLEITUNG ERNEUERN	-	0000		0



ALL

WARRANTY

MAINTENANCE

DIGITAL SERVICE SCHEDULE

CANCELLATION

VIEW COPY

Digital Service  
Schedule Reception date:  
2020-05-27Mileage:  
149913Order no.:  
165 Service record:  
Inspection with Oil  
change (flexible)

## Additional tasks

#	Number	Description
1	01400050	Brake fluid service

## Explain

Reception date:  
2020-05-26Mileage:  
149913Order no.:  
165 Invoice no.:  
201 Remark  
Maintenance

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	01090000	Insp.w.Oil change (felx.) .	X	0000		0
2	01400050	Brake fluid service .	X	0000		0
3	SERVICE	Fahrzeug ausgesaugt	-	0000		0

## Part item

#	Number	Description	Quantity	Factory code	TG	PG	Cause code	Package
1	LL003	MOTORENOEL 5W30 Longl III	4.70		6		0	0
2	N 90813202	Bolt	1.00	C	OWN	01	0	0
3	WHT000729A	Bolt	3.00	C	OWN	01	0	0
4	03N115562B	FILTERELEM	1.00	C	OWN	01	0	0
5	B 000700	BREMSFLÜSSIGKEIT	1.00		OWN		0	0
6	G 013A8J	KÜHLMITTEL	0.30		OWN		0	0
7	001100	SCHEIBENKLAR X	1.00		6		0	0
8	EMO	Ersatzmobilität Skoda Kamiq	1.00		OWN		0	0
9	WÄSCHE4	Dankeschön-Wäsche	1.00		OWN		0	0

check-CAR  
check-car.eu



ALL

WARRANTY

MAINTENANCE

DIGITAL SERVICE SCHEDULE

CANCELLATION

VIEW COPY

Explain ▼

Reception date:  
2020-04-08Mileage:  
145498Order no:  
164 Invoice no.:  
200 

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	01500000	GFF/Guided functions .	-	0000		0
2	68171902	Console removed+installed	-	0000		0
3	37032399	Mikroschaltermodul einbauen und Gru	-	0000		0

## Part item

#	Number	Description	Quantity	Factory code	TG	PG	Cause code	Package
1	5Q0713128A	SWITCH	1.00	C	OWN	08	0	0
2	SV-K600	Scheibenwischer Aeroflat Spezialada	1.00		6		0	0
3	SV-K480	Scheibenwischer Aeroflat Spezialada	1.00		6		0	0
4	MIETE	Mietfahrzeug	1.00		OWN		0	0

Explain ▼

Reception date:  
2020-04-07Mileage:  
145497Order no:  
164 Invoice no.:  
200 

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	01500000	GFF/Guided functions .	-	0000		0
2	68171902	Console removed+installed	-	0000		0
3	37032399	Mikroschaltermodul einbauen und Gru	-	0000		0

## Part item

#	Number	Description	Quantity	Factory code	TG	PG	Cause code	Package
1	5Q0713128A	SWITCH	1.00	C	OWN	08	0	0

check-car.eu

[ALL](#)[WARRANTY](#)[MAINTENANCE](#)[DIGITAL SERVICE SCHEDULE](#)[CANCELLATION](#)[VIEW COPY](#)

Digital Service  
Schedule

Reception date:  
2019-08-09

Mileage:  
120878

Order no.:  
162

Service record:  
Inspection with Oil  
change (flexible)

**Additional tasks**

#	Number	Description
1	85185550	Dust and pollen filter
2	34015550	Gearbox oil
3	01390050	Additional Inspection scope







ALL

WARRANTY

MAINTENANCE

DIGITAL SERVICE SCHEDULE

CANCELLATION

VIEW COPY

Explain

Reception date:  
2019-08-08Mileage:  
120885Order no:  
162 Invoice no.:  
191 Remark  
Maintenance

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	01220000	Dialogue Reception performed .	-	0000		0
2	01090000	Insp.w.Oil change (felx.) .	X	0000		0
3	85185550	Dust and pollen filter replaced	-	0000		0
4	01390050	Additional Inspection scope .	X	0000		0
5	01330000	Accident prev.regulations .	-	0000		0
6	34015550	Gearbox oil replaced	-	0000		0
7	SERVICE	Fahrzeug ausgesaugt	-	0000		0

## Part item

#	Number	Description	Quantity	Factory code	TG	PG	Cause code	Package
1	N 90813202	Bolt	1.00	C	OWN	01	0	0
2	WHT000729A	Bolt	3.00	C	OWN	01	0	0
3	03N115562B	FILTERELEM	1.00	C	OWN	01	0	0
4	LL003	MOTORENOEL 5W30 Longl III	4.70		6		0	0
5	5Q0819644A	Filter	1.00	C	OWN	01	0	0
6	SV-K600	Scheibenwischer Aeroflat Spezialada	1.00		6		0	0
7	SV-K480	Scheibenwischer Aeroflat Spezialada	1.00		6		0	0
8	5E9955425A	WIPERBLADE	1.00	C	OWN	13	0	0
9	G 013A8J	KÜHLMITTEL	0.20		OWN		0	0
10	02E305051C	Filterelem	1.00	C	OWN	01	0	0
11	N 91084501	Seal. ring	1.00	C	OWN	01	0	0
12	N 0438092	seal ring	1.00	C	OWN	01	0	0
13	G 052182	DSG-Oel	5.50		OWN		0	0
14	WÄSCHE4	Dankeschön-Wäsche	1.00		OWN		0	0
15	EMO	Ersatzmobilität	1.00		OWN		0	0

check-car.eu



ALL

WARRANTY

MAINTENANCE

DIGITAL SERVICE SCHEDULE

CANCELLATION

VIEW COPY

Explain

Reception date:  
2019-05-08Mileage:  
110317Order no.:  
29 Invoice no.:  
190 

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	46362050	Brake pads,front disc br. rem+inst	-	0000		0
2	46502050	Front brake discs removed+installed	-	0000		0
3	46382050	Brake pads,rear disc br. rem+inst	-	0000		0
4	46532050	Rear brake discs removed+installed	-	0000		0


## Part item

#	Number	Description	Quantity	Factory code	TG	PG	Cause code	Package
1	5Q0615301H	BRAKEDISC	2.00		OWN			0
2	8V0698151	Bremsbelag	1.00		OWN			0
3	5Q0698451M	BR. LINING	1.00		OWN			0
4	5Q0615601F	BRAKEDISC	2.00		OWN			0

Digital Service  
Schedule Reception date:  
2018-11-27Mileage:  
92726Order no.:  
15 Service record:  
Inspection with Oil  
change (flexible)

## Additional tasks

#	Number	Description
1	85185550	Dust and pollen filter
2	20345550	Diesel fuel filter
3	23245550	Air cleaner element

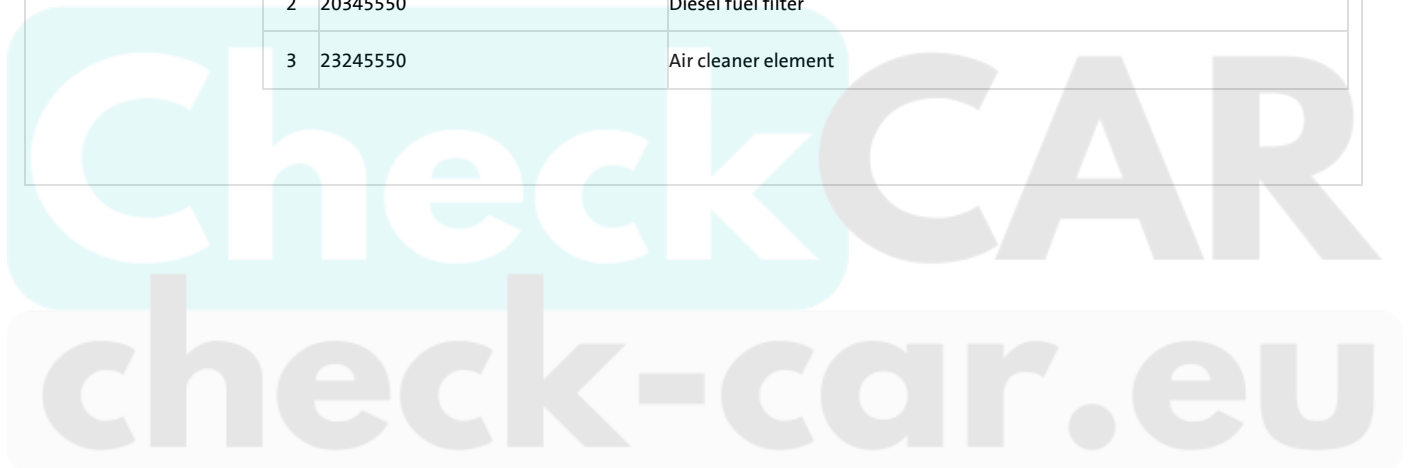



ALL

WARRANTY

MAINTENANCE

DIGITAL SERVICE SCHEDULE

CANCELLATION

VIEW COPY

Explain

Reception date:  
2018-11-26Mileage:  
92735Order no:  
159 Invoice no.:  
183 Remark  
Maintenance

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	01220000	Dialogue Reception performed .	-	0000		0
2	01090000	Insp.w.Oil change (felx.) .	X	0000		0
3	85185550	Dust and pollen filter replaced	-	0000		0
4	20345550	Diesel fuel filter replaced	-	0000		0
5	23245550	Air cleaner element replaced	-	0000		0
6	SERVICE	Fahrzeug ausgesaugt	-	0000		0

## Part item

#	Number	Description	Quantity	Factory code	TG	PG	Cause code	Package
1	N 90813202	Bolt	1.00	C	OWN	01	0	0
2	03N115562B	FILTERELEM	1.00	C	OWN	01	0	0
3	LL003	MOTORENOEL 5W30 Longl III	4.70		6		0	0
4	5Q0127177	Filtereins	1.00	C	OWN	01	0	0
5	5Q0129620B	Luftfilter	1.00	C	OWN	01	0	0
6	5Q0819653	Dust filt.	1.00	C	OWN	01	0	0
7	5E1998001	Wip. blade	1.00	C	OWN	13	0	0
8	G 013A8J	KÜHLMITTEL	0.50		OWN		0	0
9	WÄSCHE4	Dankeschön-Wäsche	1.00		OWN		0	0
10	EMO	Ersatzmobilität	1.00		OWN		0	0





ALL

WARRANTY

MAINTENANCE

DIGITAL SERVICE SCHEDULE

CANCELLATION

VIEW COPY

Explain

Reception date:  
2018-10-17Mileage:  
85691Order no.:  
159 Invoice no.:  
182 

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	70141900	Loudspeaker cover removed+installed	-	0000		0
2	66791950	Exter mech mirror housing rem+inst	-	0000		0
3	LACK	Fremdleistung : Abdeckung Spiegel L	-	0000		0

## Part item

#	Number	Description	Quantity	Factory code	TG	PG	Cause code	Package
1	5E1857507N	Housing	1.00	C	OWN	16	0	0
2	5E0857537A GRU	KAPPE	1.00	C	OWN	13	0	0
3	5E0857521	Spiegeglas	1.00	C	OWN	13	0	0

Digital Service  
Schedule Reception date:  
2018-04-20Mileage:  
62372Order no.:  
157 Service record:  
Inspection with Oil  
change (flexible)

## Additional tasks

#	Number	Description
1	34015550	Gearbox oil
2	01390050	Additional Inspection scope





ALL

WARRANTY

MAINTENANCE

DIGITAL SERVICE SCHEDULE

CANCELLATION

VIEW COPY

Explain ▼

Reception date:  
2018-04-19Mileage:  
62378Order no.:  
157 Invoice no.:  
181 Remark  
Maintenance

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	01220000	Dialogue Reception performed .	-	0000		0
2	01090000	Insp.w.Oil change (felx.) .	X	0000		0
3	01390050	Additional Inspection scope .	X	0000		0
4	34015550	Gearbox oil replaced	-	0000		0
5	92272050	Wiper blade removed+installed	-	0000		0
6	01330050	Accident prev.regulations .	-	0000		0
7	44052004	Wheels removed+installed	-	0000		0
8	44059400	Wheels balanced	-	0000		0
9	44104199	Scheibenrad vo re nach Anstoß insta	-	0000		0
10	Service	Fahrzeug ausgesaugt	-	0000		0

## Part item

#	Number	Description	Quantity	Factory code	TG	PG	Cause code	Package
1	LL003	MOTORENOEL 5W30 Longl III	4.70		6		0	0
2	N 90813202	Bolt	1.00	C	OWN	01	0	0
3	03N115562	Filterelem	1.00	C	OWN	01	0	0
4	PMS1C1	Pluum Scheibenreiniger Sommer	1.50		6		0	0
5	02E305051C	Filterelem	1.00	C	OWN	01	0	0
6	N 91084501	Seal. ring	1.00	C	OWN	01	0	0
7	N 0438092	seal ring	1.00	C	OWN	01	0	0
8	G 052182	DSG-Oel	5.50		OWN		0	0
9	5E1998001	Wip. blade	1.00	C	OWN	13	0	0
10	5E9955425A	WIPERBLADE	1.00	C	OWN	13	0	0
11	EMO	Ersatzmobilität	1.00		OWN		0	0
12	WÄSCHE4	Dankeschön-Wäsche	1.00		OWN		0	0

Digital Service  
ScheduleReception date:  
2017-08-11Mileage:  
29142Order no.:  
154 Service record:  
Inspection with Oil  
change (flexible)

[ALL](#)[WARRANTY](#)[MAINTENANCE](#)[DIGITAL SERVICE SCHEDULE](#)[CANCELLATION](#)[VIEW COPY](#)

Explain

Reception date:  
2017-08-09Mileage:  
29154Order no.:  
154 Invoice no.:  
171 Remark  
Maintenance

## Repair operation

#	Number	Description	Maintenance	Paint	Cause code	Package
1	01220000	Dialogue Reception performed .	-	0000		0
2	01090000	Insp.w.Oil change (felx.) .	X	0000		0
3	92272000	Wiper blade removed+installed	-	0000		0
4	Service	Fahrzeug ausgesaugt	-	0000		0

## Part item

#	Number	Description	Quantity	Factory code	TG	PG	Cause code	Package
1	LL003	MOTORENOEL 5W30 Longl III	4.70		6		0	0
2	03N115562	Filterelem	1.00	C	OWN	01	0	0
3	N 90813202	Bolt	1.00	C	OWN	01	0	0
4	001100	Scheibenklar X	1.00		6		0	0
5	SV-K480	Scheibenwischer Aeroflat Spezialada	1.00		6		0	0
6	SV-K600	Scheibenwischer Aeroflat Spezialada	1.00		6		0	0
7	EMO	Ersatzmobilität	1.00		OWN		0	0
8	WÄSCHE4	Dankeschön-Wäsche	1.00		OWN		0	0

Digital Service  
Schedule Reception date:  
2016-11-03Mileage:  
0Order no.:  
2016 Service record:  
Delivery inspection

#	Description	Remark
1	Description	Delivery inspection
2	Remark	

Showing 1 to 25 of 25 entries (filtered from 26 total entries)

Previous

1

Next

check-car.eu

## Vehicle identification

Vehicle ID no	TMB	232
Delivery date	2017-03-11	
Next main inspection	2023-11	
Next exhaust emissions test	2023-11	
Type	5E538C	

## Vehicle data

Attribute	Vehicle data
Vehicle Identification No.	TMBJJ7NE
Model	Octavia OCT
Date of production	19.10.
Year	2017
Sales type	5E5
Engine Code	CRMB
Transmission Code	QMM
Axle drive	6A
Equipment	HA
Roof color	Z5
Exterior color / Paint Code	Z5 / F5A

## PR Number

Attribute		Description
Special editions	E0A	no sales campaign version
Lockable wheel bolts	1PA	Standard wheel bolts
Adapter (for trailer hitch)	ND0	Without adapter
Vehicle class differentiation powertrains/platform parts	7LM	Vehicle class differentiation -5E0-
Tailpipes	0P0	Rear exhaust tailpipe (standard)
Hill start assist	UG1	Hill start assist
Emission standard	7MM	Emission standard EU6 plus
Trailer hitch	1D0	Without trailer hitch
Airbag	4UP	Airbag for driver and front passenger with knee airbag and front passenger airbag deactivation
Activated carbon canister/gasoline particulate filter	1E0	Without activated carbon canister
Storage compartment package	QE1	Storage compartment package 1
Overhead storage compartment	7N2	spectacles holder
Antennas	8ZH	Antenna for AM/FM reception, "diversity"
Exterior mirror adjustment	6XD	Exterior mirrors, power-adjustable/ heated
Follow-on warranty	EA0	Without subsequent warranty
Left exterior mirror	5SJ	Left exterior mirror, convex

## Vehicle data

Attribute		Description
Electronic engine sound measures	GM1	Standard electronic engine sound
Right exterior mirror	5RQ	Exterior mirror, right, convex
Alternative drive system	0K0	Without alternative drive system
Drive type	1X0	Front-wheel drive
Multimedia/video/DVD/notebook connection	9WT	MirrorLink
Equipment lines	A8C	Comfort equipment
Stopping distance reduction system	6K0	Without forward collision warning/ autonomous emergency braking
Rear brakes	1KD	Disc brakes in rear
Batteries	J2D	Battery 380 A (68 Ah)
Front brakes	1ZE	Disc brakes in front (Geomet D)
Components with special surfaces	6FF	Exterior mirror housing and various attachments colour coded to vehicle
Controls (steering wheel/steering column)	4LC	Controls for radio and telephone
Part set for country-specific prescriptive standards	B0A	parts set (non-country specific fitting instruction)
Vehicle tools and jack	1S1	Vehicle tools and jack
Brake systems	1AT	Electronic stability control (ESC)
Owner's manuals	0VC	Information kit in German
Operating voltage	9Z0	Operating voltage 12 V
Brake pad wear indicator	9U0	without brake wear indicator
Heated washer nozzles	9T1	Heated washer nozzles in front
CD-ROM/DVD/SD card	7RE	SD card (Europe)
Driving mode selection	2H0	Without "drive select"
Chrome package	QJ9	Chrome package
General operating license additions	C00	Operating permit, initial registration
Roof rails/roof rack	3S2	Black roof rails
Roof insert/convertible top	3FA	Without roof insert (standard roof)
Shock absorption in rear	UC7	Rear shock absorption, chassis with increased ride height
Shock absorption in front	G03	Shock absorption in front
Differential lock	1Y3	Electronic differential lock XDS, dynamic traction support
Load-through hatch/ski bag	3X0	not with through-loading aperture
Tank filler neck for unleaded fuel/fuel type	2G5	Filler neck module 1 without insert
Eco feature for driver profile and driving mode selection	EF0	without ECO function
Installation differentiation for vehicle parts	0ES	Installation differentiation for transmission DQ250 -- vehicle components --
Theft protection system	7AA	Electronic immobilizer
Inserts	5MC	Decorative inserts
Scuff plates	7M5	Without impact protection film for door sill
Park distance control	7X2	Park distance control in front and rear
Extended safety system	7W0	No enhanced safety system
Electric interface for external use	UI4	External, AUX-IN jack, USB type A, 1x USB socket
Differentiation for manufacturing process	0FA	Standard manufacturing sequence



## Vehicle data

Attribute		Description
Window regulator	4R4	Power windows with comfort operation and circuit breaker
Malfunction display	9HA	Without additional malfunction display
Pedestrian protection	VL0	Standard pedestrian detection measures
Pedal cluster	VF0	Foot pedal unit"standard"
Headlight control	8K1	Separate daytime running light
Fresh air intake for vehicle interior (with particle filter)	2V1	dust and pollen filter
Parking brake	UH0	Parking brake
Vehicle tracking system	7G0	Without preparation for VTS (Vehicle Tracing System)
Vehicle specifications	F0A	No special purpose vehicle, standard equipment
Sound insulation measures for interior noises	3W3	Special interior noise insulation
Alternators	8GU	Alternator 140 A
Weight category for rear axle	0YE	Weight range 5 installation control only, no requirement forecast
Weight category for front axle	L28	Suspension range 28 installation control only, no requirement forecast
Base engine	TS1	4-cylinder diesel engine 2.0 l unit 04L.B
Luggage compartment cover	3U2	Sliding luggage compartment cover
Tie down straps/net/pocket	6M0	Without tie down straps/net/pocket
cruise control system	8T2	Electronic cruise control system (CCS)
Luggage compartment lighting	9E3	Luggage compartment lighting
Sound insulation measures for outside noises	2B1	Additional exterior noise insulation
Transmission specification	G1A	6-speed automatic transmission
Hand brake lever	6PC	Hand brake lever handle in leather
Wiper and washer system for rear windows	8M1	Rear window wiper washer system with intermittent wipe
Rear axle	0N1	Standard rear axle
Rear seats	3NU	Rear bench seat, not split, split backrest, folding centre armrest
Heating system/air conditioning system	KH6	Air conditioning system with electronic control
Main headlamps	8ID	Halogen twin headlamps
Hybrid drive	20A	Without electric motor (hybrid)
Interior lighting in footwell	6T0	Without interior light in footwell
Dashboard inserts	U5A	Instrument cluster, km/h speedometer
Breakaway interior rearview mirror	4L2	Breakaway interior rearview mirror, dimming
Labels (customer specific or campaigns)	0KA	Without decals and emblems
Body forms	K8D	Wagon/Avant
Camera/distance sensor	QK0	Without multifunction camera
Luggage compartment floor covering	6SG	Luggage compartment floor covering "Comfort"
Cool box	1W2	Glove compartment cooling system
Flaps/storage compartments in the luggage compartment	3N2	Storage compartments with cover in trunk side panel

## Vehicle data

Attribute		Description
Folding table	1U8	W/o folding table on front seat backrest
Climate zones	0Y1	Standard climatic zones
Compass/road sign display	QR8	without road sign recognition
Head restraints in rear	3T2	3 rear head restraints
Head restraints	5ZF	Front head restraints
Fuel filling volume	1Z0	Initial standard fuel filling
Categorization for tires	A65	Category 5
Fuel systems	0F5	Fuel system for diesel engine
Body measures	5C0	Without special body measures
Child seat anchors in front	3G0	Without child seat anchora in front (ISOFIX)
Camera systems/surround sensors	KA0	without camera systems/environment sensors
Refrigerant	KK3	Refrigerant R1234yf
Paint preservation/transport protection	5K7	Transport protection film (minimum protection) with additional transport protection measures
Paint finish	FB0	Normal paintwork
Luggage/load compartment floor in rear	3GA	Without luggage compartment floor
Lighting package (lighting)	QQ0	Without add. lights (interior lighting)
Vehicle inlets	ES0	Without vehicle inlet
Steering system setup	L0L	Left-hand drive
reading light	8S4	Two reading lights in front, two in rear
Steering system	1N3	Speed-related variable steering assist (Servotronic)
Backrest release	3H0	Without backrest release for front seats
Light assist systems	8G0	Without Light Assist
Lumbar support in backrests	7P4	Manually adjustable lumbar support in front seats
Steering wheels	2PK	Leather-wrapped multi-function sports steering wheel with tiptronic
Driving on the left/right side	AV1	Driving on the right
Loudspeaker installation	8RM	8 speakers (passive)
Headlight range control	8Q1	Headlight range control
Center armrest	6E3	Center armrest in front
Variants	FM0	Basic equipment variant
Multi-function display/trip computer	9S5	Multi-function display/trip computer "Medium"
Center console	3D7	Center console
Driver alert system	EM0	Without driver alert system
Engine cooling	8Z5	not hot country
Engine specification	DN4	4-cyl. turbo diesel engine 2.0 l/110 kW (4V) TDI common rail; b.engine T37/T6F TS1/TR1/TOP/T0N/T13/T29/TM4/TD1/TI9/T1I
Navigation system	7UF	Navigation system - Standard
rear fog lamp	8TB	rear fog lamp
Front fog lamps/additional headlamps	8WB	Front fog lamps
Online services	EL0	Without online service
Rear floor panel platform module	4P3	Rear floor panel module, type 4
Wheel trims	1NJ	Wheel trims
Wheels	CZ0	Steel wheels 6.5j x 16 weight-optimized

## Vehicle data

Attribute		Description
Radios	I8E	Radio Standard (Gen2)
Smoker's/non-smoker's version	9JA	Non-smoker version
Regional codes for radio	ER1	Regional code " ECE " for radio
Tire pressure monitoring system	7K1	Tire pressure monitoring system
Tires 215/45 R16 86V	HH7	Tires 205/55 R16 91V
Tire suppliers	V1P	Tire suppliers for EU countries
Spare wheel/breakdown kit	1G2	Steel spare wheel with original equipment tire
Wheelbases	0B3	Wheelbase
Restraint systems in front	3QM	3-point seat belts, front
Call feature	NZ0	without emergency call control unit
	PJB	Steel spare wheel, car jack, wheel wrench
	PK4	Rough road package
	WN3	Business Amundsen
Side airbag	4X3	Side airbag in front, with curtain airbag
Gearshift knob/gearshift handle	6Q2	Gearshift knob/handle in leather
Special labels	2KW	Labels in German, French and Dutch
Rear combination lamps	8SA	Rear combination lamp, standard design
Closing/opening mechanism tailgate/trunk lid/rear gate	4E2	Tailgate/trunk lid release from inside (electrically)
Service indicator	QI6	Service indicator 30 000 km or 2 years ( variable )
Seat belt reminder	9P5	Visual and acoustic seat belt reminder, electric contact
Seat trim covers	N2C	Seat trim covers in fabric
Seat adjustment	3L3	Manual height adjustment for front seats
seat heater	4A0	without seat heater
Key for locking system	8QL	Key for locking system with remote control
Start-stop system/regenerative braking	7L6	Start-stop system with regenerative braking
Horns	8Y1	Two-tone horn
Control code (no PR family)	SI1	Price support
sun visors	5XB	Sun visors with mirror and airbag label on front passenger side
Voice control system/voice control	QH1	Voice control
Lane change system/lane keeping system	7Y0	No lane change assistant
Side and rear windows	4KF	heat protective glass for door, side and rear windows, darkened from b-pillar
Sun blind for rear/side windows	3Y0	without roll-up sun screen
Supertone system and successive tone alarm control	9J0	Without supertone system and tone sequence control
Outlet	7B2	12 Volt socket in luggage compartment
Bumper	2JB	Standard bumpers
Rear stabilizer bar	0BA	Without rear stabilizer bar
Front stabilizer bar	0AD	Front stabilizer bar
Headlamp washer system	8X0	Without headlamp washer system
Intermittent windshield wiper control/ light/rain sensor	8N4	Windshield wiper intermittent control with potentiometer (four speeds)

## Vehicle data

Attribute		Description
Mud flaps	6N0	without mud flaps
Fuel cap/fuel filler door closing mechanism	2W6	Fuel filler cap
Counterweights for steering wheels	1Q0	steering wheel without balance weight
Door and tailgate/trunk lid locking mechanism	4I2	Central locking w/ radio remote control, interior controls, without SAFELOCK
Type-approval testing countries/countries with specific requirements	B01	Type approval country Germany
Carrier frequency for remote control	5D1	Carrier frequency 433.92 to 434.42 Mhz
Partition	3CX	Net partition
Door and side trim panels	3LD	door and side trim panels
Doors	0A2	4 doors
TV reception/digital radio reception	QV3	digital radio reception
Front-end underbody cladding	1SK	Additional front underbody guard plus underbody stone guard
Identification labels	1EX	Special identification label for EC for M1 passenger vehicles
Delivery equipment	2A0	Without delivery equipment
Two-way radio installation preparation	9D0	without preparation for two-way radio system
Front seats	Q1A	Standard seats in front
Rear seat catch	UK1	Standard rear seat release
Telephone/telematics	9IH	Comfort telephony with WLAN and LTE and wireless charging
Additional warning lamps	9TC	Additional retro-reflectors (door area)
LongLife Service Regime	QG1	LongLife Service Regime
Thermal energy storage system/auxiliary heater	7E6	Electric auxiliary air heater
Windshield	4GF	Heat-reflecting windshield
Washer fluid level indicator	8W1	Washer fluid level indicator
Additional tires (snow tires)	2WA	without spare tyre
foot mats	0TA	without foot mats
Decorative trims	4ZE	Black decorative trims
Additional child seat anchorage	3B4	Child seat anchors for child seat system ISOFIX
Auxiliary heater	9M0	Without auxiliary heater/parking heater

**CheckCAR**  
check-car.eu

**FULL DIGITAL SERVICE HISTORY RECORDS | 100% DETAILED | DIRECTLY FROM THE DEALERSHIP**

